

# Infrared CO2 Sensor Module (Model: MH-Z19C)

## **User's Manual**

(Version 1.2)

Issue Date. 2021.05.14

Zhengzhou Winsen Electronics Technology Co., Ltd

ISO9001 Certificated Company

 Tel: 86-371-67169097/67169670
 Fax: 86-371-60932988
 Email: sales@winsensor.com

 Leading gas sensing solutions supplier in China!

## Statement

This manual's copyright belongs to Zhengzhou Winsen Electronics Technology Co., LTD. Without the written permission, any part of this manual shall not be copied, translated, stored in database or retrieval system, also can't spread through electronic, copying, record ways.

Thanks for purchasing our product. In order to let customers use it better and reduce the faults caused by misuse, please read the manual carefully and operate it correctly in accordance with the instructions. If users disobey the terms or remove, disassemble, change the components inside of the sensor, we shall not be responsible for the loss.

The specific such as color, appearance, sizes &etc., please in kind prevail.

We are devoting ourselves to products development and technical innovation, so we reserve the right to improve the products without notice. Please confirm it is the valid version before using this manual. At the same time, users' comments on optimized using way are welcome.

Please keep the manual properly, in order to get help if you have questions during the usage in the future.

Zhengzhou Winsen Electronics Technology CO., LTD.

## MH-Z19C NDIR CO2 Module

\*Air cleaner device

\*Smart home

\*School

#### Profile

MH-Z19C NDIR infrared gas module is a common type, small size sensor, pins type or terminal type, using non-dispersive infrared (NDIR) principle to detect the existence of CO2 in the air, with good selectivity, non-oxygen dependent and long life. Built-in temperature compensation; and it has UART output and PWM output. It is developed by the tight integration of mature infrared absorbing gas detection technology, precision optical circuit design and superior circuit design.

#### Applications


- \*HVAC refrigeration
- \*Indoor air quality monitoring
- \*Ventilation system
- Main Features
- \*Chamber is gold plated
- \*High sensitivity, low power consumption
- \*Good stability
- \*Temperature compensation, excellent linear output
- \*Multiple output modes: UART, PWM
- \*Long lifespan
- \*Anti-water vapor interference, anti-poisoning

#### **Main parameters**

Model No.	MH-Z19C			
Detection Gas	CO2			
Working voltage	$5.0\pm0.1$ V DC			
Average current	< 40mA (@5V power supply)			
Peak current	125mA (@5V power supply)			
Interface level	3.3 V (Compatible with 5V)			
Detection Range	400~10000ppm(optional)			
	Serial Port (UART) (TTL level 3.3V)			
Output signal	PWM			
Preheat time	1 min			
Response Time	T <sub>90</sub> < 120 s			
Working temperature	-10 ~ 50 °C			
Working humidity	0 ~ 95% RH (No condensation)			
Storage temperature	-20~60 °C			
Weight	5 g			
Lifespan	> 10 years			

Tel: 86-371-67169097/67169670 Fax: 86-371-60932988

Email: sales@winsensor.com

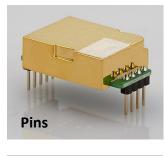





#### **Detection range and accuracy**


Detection Gas	Formula	Detection Range	Resolution	Accuracy	
Carban		400~2000ppm			
Carbon Dioxide	CO2	400~5000ppm	1ppm	± (50ppm+5% reading value)	
		400-10000ppm			


## **Dimensions(Pins type)**



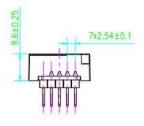





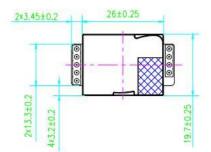

#### Pins connection type:

Pin	Pin Definition				
Vin	Positive pole of power (Vin)				
GND	Negative pole of power (GND)				
PWM	PWM				
Hd	HD(zero point calibration, low level				
	lasting for over 7s is effective)				
Rx	UART(RXD)TTL Level data input				
Тх	UART(TXD)TTL Level data output				


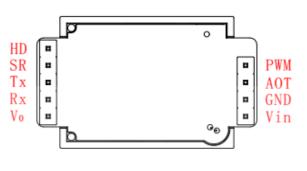


Fig3.from bottom

 Tel: 86-371-67169097/67169670
 Fax: 86-371-60932988
 Email: sales@winsensor.com

 Leading gas sensing solutions supplier in China!

## **Dimensions(Terminal type)**

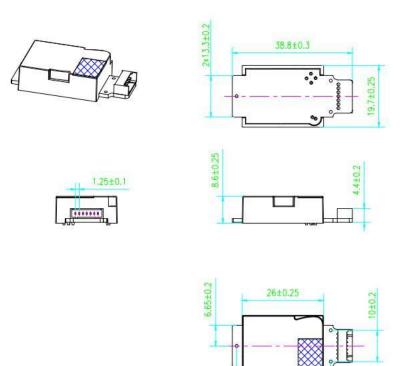


1.38±0.15

31.5±0.25

## **Terminal connection type**

Pin	Terminal pin Definition				
Pin 4	Vin power in				
Pin 3	GND				
Pin 2	Reserved				
Pin 7	PWM				
Pin 1	HD(zero point calibration, low level lasting for over 7s is effective)				
Pin 5	UART(RXD)TTL Level data input				
Pin 6	UART(TXD)TTL Level data output				

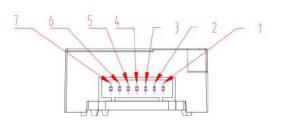


#### Fig4.Terminal connection version

#### Output

PWM output	
Take 400~2000	ppm for example
CO2 output range	400~2000ppm
Cycle	1004ms±5%
Cycle start high level output	2ms (theoretical value)
The middle cycle	1000ms±5%

Tel: 86-371-67169097/67169670 Fax: 86-371-60932988

Email: sales@winsensor.com

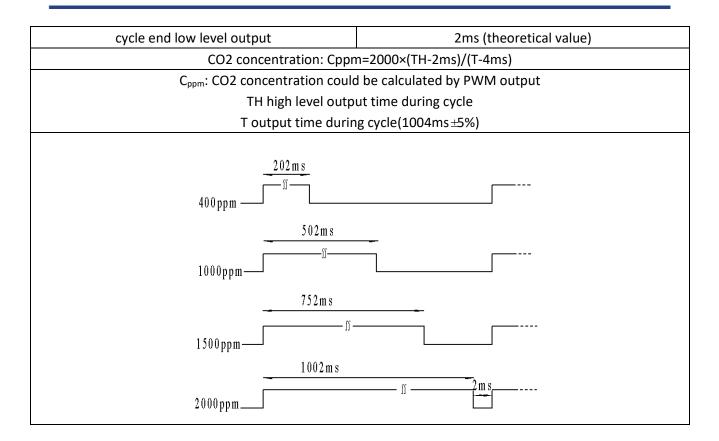

#### Serial port output (UART)

#### Hardware connection

Connect module's Vin-GND-RXD-TXD to users' 5V-GND-TXD-RXD.

(Users must use TTL level. If RS232 level, it must be converted.)

#### Software setting

Set serial port baud rate be 9600, data bit 8 bytes, stop bit 1byte, parity bit null.

Commands				
0x86	Read CO2 concentration			
0x79	Turn on/off self-calibration function			

0x86- Read	CO2 concent	ration						
Sending co	mmand							
Byte0	Byte1	Byte2	Byte3	Byte4	Byte5	Byte6	Byte7	Byte8
Start	Reserved	Comm	-	-	-	-	-	Checksu
Byte		and						m
0xFF	0x01	0x86	0x00	0x00	0x00	0x00	0x00	0x79
Return valu	le							
Byte0	Byte1	Byte2	Byte3	Byte4	Byte5	Byte6	Byte7	Byte8
Start	Command	Concen	Concentr	-	-	-	-	Checksu
Byte		tration	ation					m
		(High 8	(Low 8					
		Byte)	Byte)					

Tel: 86-371-67169097/67169670 Fax: 86-371-60932988

Email: sales@winsensor.com

#### Winsでの 炸盛科技Zhengzhou Winsen Electronics Technology Co., Ltd

0xFF	0x86	HIGH	LOW	-	-	-	-	Checksu m
								111
•			= HIGH * 256		· · · · · · · · · · · · · · · · · · ·	. 4 havedaa		-la -i
			convert nexa	decimal 01	. into decima	al 1, hexadeci	mai F4 Into	decimal 244
then 1.55	6+244=500p	рш						
0x79- On/0	Off Self-calib	ration for Zer	o Point					
	and-No retur							
Byte0	Byte1	Byte2	Byte3	Byte4	Byte5	Byte6	Byte7	Byte8
Start Byte	Reserved	Command	-	-	-	-	-	Checksun
0xFF	0x01	0x79	0xA0/0x00	0x00	0x00	0x00	0x00	Checksun
	calculation		e3+Byte4+Byte5	-Byte6+Byte	7))+1			
For example	:							
Byte0	Byte1	Byte2	Byte3	Byte4	Byte5	Byte6	Byte7	Byte8
Start Byte	Reserved	Command	-	-	-	-	-	Checksum
0xFF	0x01	0x86	0x00	0x00	0x00	0x00	0x00	Checksum
Calculating C	hecksum:			·		·	·	
1、Add Byte	1 to Byte 7: 0	x01 + 0x86 + 0x	x00 + 0x00 + 0x0	00 + 0x00 + 0	x00 = 0x87			
2、Negative	: 0xFF - 0x87 =	0x78						
3、Then+1:	0x78 + 0x01 =	= 0x79						
C languag	e							
char getC	heckSum(c	har *packet	)					
{								
•								

```
cnar i, cnecksum;
for( i = 1; i < 8; i++)
{
checksum += packet[i];
}
checksum = 0xff – checksum;
```

#### **Zero Point Calibration**

This module has two methods for zero point calibration: hand-operated method and self-calibration. All the zero point is at 400ppm CO2.

#### Hand-operated method: Connect module's HD pin to low level(0V), lasting for 7 seconds at least. Before calibrating the zero point, please ensure that the sensor is stable for more than 20 minutes at 400ppm ambient environment. Self-calibration:

Tel: 86-371-67169097/67169670 Fax: 86-371-60932988

Email: <u>sales@winsensor.com</u>

After the module works for some time, it can judge the zero point intelligently and do the zero calibration automatically. The calibration cycle is every 24 hours since the module is power on. The zero point is 400ppm.

This method is suitable for office and home environment, not suitable for agriculture greenhouse, farm, refrigerator, etc.. If the module is used in latter environment, please turn off this function.

#### Notes

- Please avoid the pressure of its gilded plastic chamber from any direction, during welding, installation, and use.
- When placed in small space, the space should be well ventilated, especially for diffusion window.
- To ensure the normal work, the power supply must be among 4.5V~5.5V DC rang, the power current must be not less than 150mA. Out of this range, it will result in the failure of the sensor. (The concentration output is low, or the sensor cannot work normally.)
- The module should be away from heat, and avoid direct sunlight or other heat radiation.
- The module should be calibrated termly, the suggested period is no longer than 6 months.
- Do not use the sensor in the high dusty environment for long time.
- During the zero-point calibration procedure by manual or sending command, the sensor must work in stable gas environment (400ppm) for over 30 minutes.
- Forbid using wave soldering for the sensor.
- When soldering with soldering iron, set the temperature to be (350  $\pm$  5)  $^{\circ}$  C, and soldering time must be within 3 seconds.

Zhengzhou Winsen Electronics Technology Co., Ltd
Add: No.299, Jinsuo Road, National Hi-Tech Zone, Zhengzhou 450001 China
Tel: +86-371-67169097/67169670
Fax: +86-371-60932988
E-mail: sales@winsensor.com
Website: www.winsen-sensor.com