

## **Freon Gas Sensor**

(Model:WSP5110)

# Manual

Version: 1.4

Valid From: 2016.08.16

Zhengzhou Winsen Electronics Technology Co., Ltd

## **Statement**

This manual copyright belongs Zhengzhou Winsen Electronics Technology Co., LTD. Without the written permission, any part of this manual shall not be copied, translated, stored in database or retrieval system, also can't spread through electronic, copying, record ways.

Thanks for purchasing our product. In order to let customers use it better and reduce the faults caused by misuse, please read the manual carefully and operate it correctly in accordance with the instructions. If users disobey the terms or remove, disassemble, change the components inside of the sensor, we shall not be responsible for the loss.

The specific such as color, appearance, sizes &etc, please in kind prevail.

We are devoting ourselves to products development and technical innovation, so we reserve the right to improve the products without notice. Please confirm it is the valid version before using this manual. At the same time, users' comments on optimized using way are welcome.

Please keep the manual properly, in order to get help if you have questions during the usage in the future.

Zhengzhou Winsen Electronics Technology CO., LTD

#### **WSP5110 Freon Gas Sensor**

#### **Profile**

WSP5110 freon gas sensor adopts multilayer thick film manufacturing technology. The heater and metal oxide semiconductor material on the ceramic substrate of subminiature  $Al_2O_3$  are fetched out by electrode down-lead, encapsulated in metal socket and cap. Conductivity of the sensor is affected by the concentration of target gas. The higher the concentration is, the higher conductivity of sensor gets. Users can adopt simple circuit to convert variation of conductivity into output signal corresponding to gas concentration.



#### **Features**

High sensitivity to freon, benzene; quick response and resume; low power consumption, simple detection circuit, good stability and long life.

#### **Main Application**

It is used in domestic, environmental occasions for freon gas detection.

#### Technical Parameters Stable 1.

Model			WSP5110
Sensor Type			Semiconductor flat surfaced
			sensor
Standard Encapsulation			Metal Cap
Detection Gas			Freon, benzene, alcohol &etc.
Detection range			10 $\sim$ 1000ppm
Standard circuit	Loop voltage	$V_{\text{C}}$	≤24V DC
	Heating voltage	$V_{H}$	5.0V±0.1V AC or DC
	Load resistance	$R_L$	Adjustable
sensor features in standard test condition	Heating resistance	R <sub>H</sub>	$90\Omega\pm10\Omega$ (Room Tem.)
	Heating consumption	P <sub>H</sub>	≤300mW
	Surface resistance	$R_{S}$	$30$ Κ $\Omega$ $\sim$ $200$ Κ $\Omega$ (in 100ppm freon)
	Sensitivity	S	Rs(in air)/Rs(in 100ppm freon)≥3
	Concentration slope	α	≤0.65(R <sub>200ppm</sub> /R <sub>50ppm 編利昂</sub> )
Standard condition of test	Temperature, humidity		20℃±2℃; 65%±5%RH
	Standard test circuit		Vc:5.0V±0.1V; V <sub>H</sub> :5.0V±0.1V
	Warm-up time		More than 120 hours

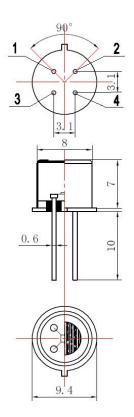


Fig1.Sensor Structure



#### **Basic Circuit**

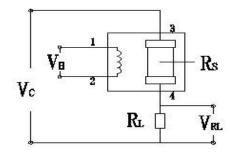


Fig2. WSP5110 Test Circuit

**Instructions:** The above fig is the basic test circuit of WSP5110. The sensor requires two voltage inputs: heater voltage ( $V_H$ ) and circuit voltage ( $V_C$ ).  $V_H$  is used to supply standard working temperature to the sensor and it can adopt DC or AC power, while  $V_{RL}$  is the voltage of load resistance  $R_L$  which is in series with sensor. Vc supplies the detect voltage to load resistance  $R_L$  and it should adopts DC power.

#### **Description of Sensor Characters**


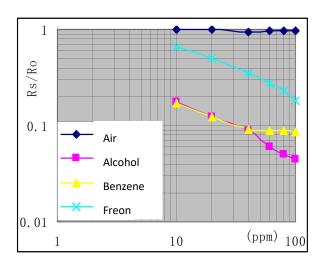


Fig3.Typical Sensitivity Curve

Rs means resistance in target gas with different concentration,  $R_0$  means resistance of sensor in clean air. All tests are finished under standard test conditions.

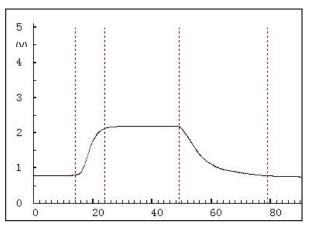

Output Voltage (V)


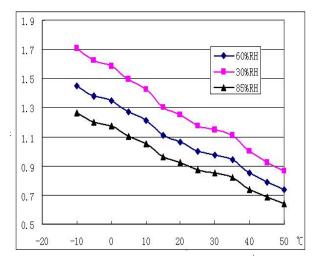


Fig4.Typical temperature/humidity characteristics

Rs means resistance of sensor in 100ppm freon under different tem. and humidity. Rso means resistance of the sensor in clean air under 20  $^{\circ}$ C/55%RH.

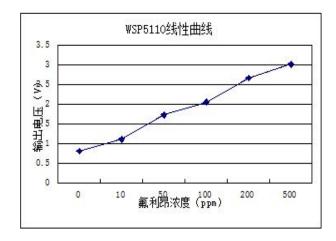

re(s) Freon Concentration (ppm)

### Fig5.Responce and Resume

Fig6.Linearity curve

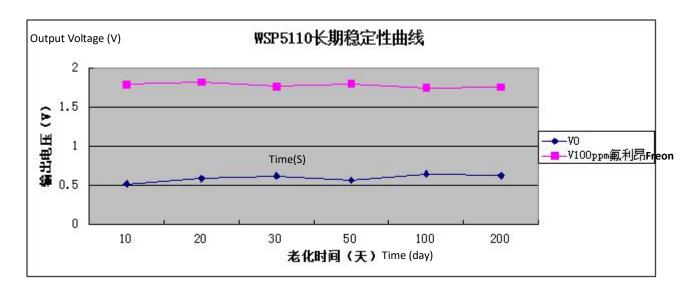


Fig7.long-term Stability of WSP2110

NOTE: Test is finished in standard test conditions, the abscissa is observing time and the ordinate is V<sub>RL</sub>.

#### **Cautions**

#### 1. Following conditions must be prohibited

1.1 Exposed to volatilizable organic silicon steam

Sensing material will lose sensitivity and never recover if the sensor absorbs organic silicon steam. Sensors must avoid exposing to silicon bond, fixature, silicon latex, putty or plastic contain silicon environment.

1.2 High Corrosive gas

If the sensors are exposed to high concentration corrosive gas (such as  $H_2S$ ,  $SO_X$ ,  $Cl_2$ , HCl etc.), it will not only result in corrosion of sensors structure, also it cause sincere sensitivity attenuation.

1.3 Alkali, Alkali metals salt, halogen pollution

The sensors performance will be changed badly if sensors be sprayed polluted by alkali metals salt especially brine, or be exposed to halogen such as fluorine.

1.4 Touch water

Sensitivity of the sensors will be reduced when spattered or dipped in water.

1.5 Freezing



Do avoid icing on sensor's surface, otherwise sensing material will be broken and lost sensitivity.

#### 1.6 Applied higher voltage

Applied voltage on sensor should not be higher than stipulated value, even if the sensor is not physically damaged or broken, it causes down-line or heater damaged, and bring on sensors' sensitivity characteristic changed badly.

#### 1.7 Voltage on wrong pins

As Fig8,Pin 1&2 connects to heater circuit, Pin 3&4 connects to measuring circuit; Under the requested conditions, heating and measuring can use the same power circuit.

NOTE: the two pins near the protuberance mark is heating electrode.

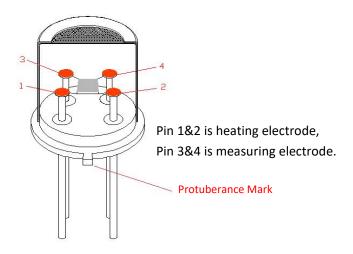


Fig8.Pin Schematic Diagram

#### 2 .Following conditions should be avoided

#### 2.1 Water Condensation

Indoor conditions, slight water condensation will influence sensors' performance lightly. However, if water condensation on sensors surface and keep a certain period, sensors' sensitive will be decreased.

#### 2.2 Used in high gas concentration

No matter the sensor is electrified or not, if it is placed in high gas concentration for long time, sensors characteristic will be affected. If lighter gas sprays the sensor, it will cause extremely damage.

#### 2.3 Long time storage

The sensors resistance will drift reversibly if it's stored for long time without electrify, this drift is related with storage conditions. Sensors should be stored in airproof bag without volatile silicon compound. For the sensors with long time storage but no electrify, they need long galvanical aging time for stability before using. The suggested aging time as follow:

Stable2.

Storage Time	Suggested aging time
Less than one month	No less than 48 hours
1 ~ 6 months	No less than 72 hours
More than six months	No less than 168 hours



#### 2.4 Long time exposed to adverse environment

No matter the sensors electrified or not, if exposed to adverse environment for long time, such as high humidity, high temperature, or high pollution etc., it will influence the sensors' performance badly.

#### 2.5 Vibration

Continual vibration will result in sensors down-lead response then break. In transportation or assembling line, pneumatic screwdriver/ultrasonic welding machine can lead this vibration.

#### 2.6 Concussion

If sensors meet strong concussion, it may lead its lead wire disconnected.

#### 2.7 Usage Conditions

2.7.1For sensor, handmade welding is optimal way. The welding conditions as follow:

- Soldering flux: Rosin soldering flux contains least chlorine
- homothermal soldering iron
- Temperature: 250°C
- Time: less than 3 seconds
  - 2.7.2If users choose wave-soldering, the following conditions should be obey:
- Soldering flux: Rosin soldering flux contains least chlorine
- Speed: 1-2 Meter/ Minute
- Warm-up temperature: 100±20°C ■ Welding temperature: 250±10°C
- One time pass wave crest welding machine

If disobey the above using terms, sensors sensitivity will reduce.

Zhengzhou Winsen Electronics Technology Co., Ltd

Add: No.299, Jinsuo Road, National Hi-Tech Zone, Zhengzhou 450001 China

**Tel:** +86-371-67169097/67169670

Fax: +86-371-60932988

Tel: 86-371-67169097/67169670 Fax: 86-371-6093 298911: sales@winsensor.cemail:sales@winsensor.com

Website: www.winsen-sensor.com